


Ground Vibration Report

Summary

Event Type	Seismic Event
Magnitude	1.1
Event Date	2026/05/02
Event Time	18:58:13 Australia/Melbourne
Location	Phoenix 3690 ACC
Distance Below Surface	~1460 m
Notes	-

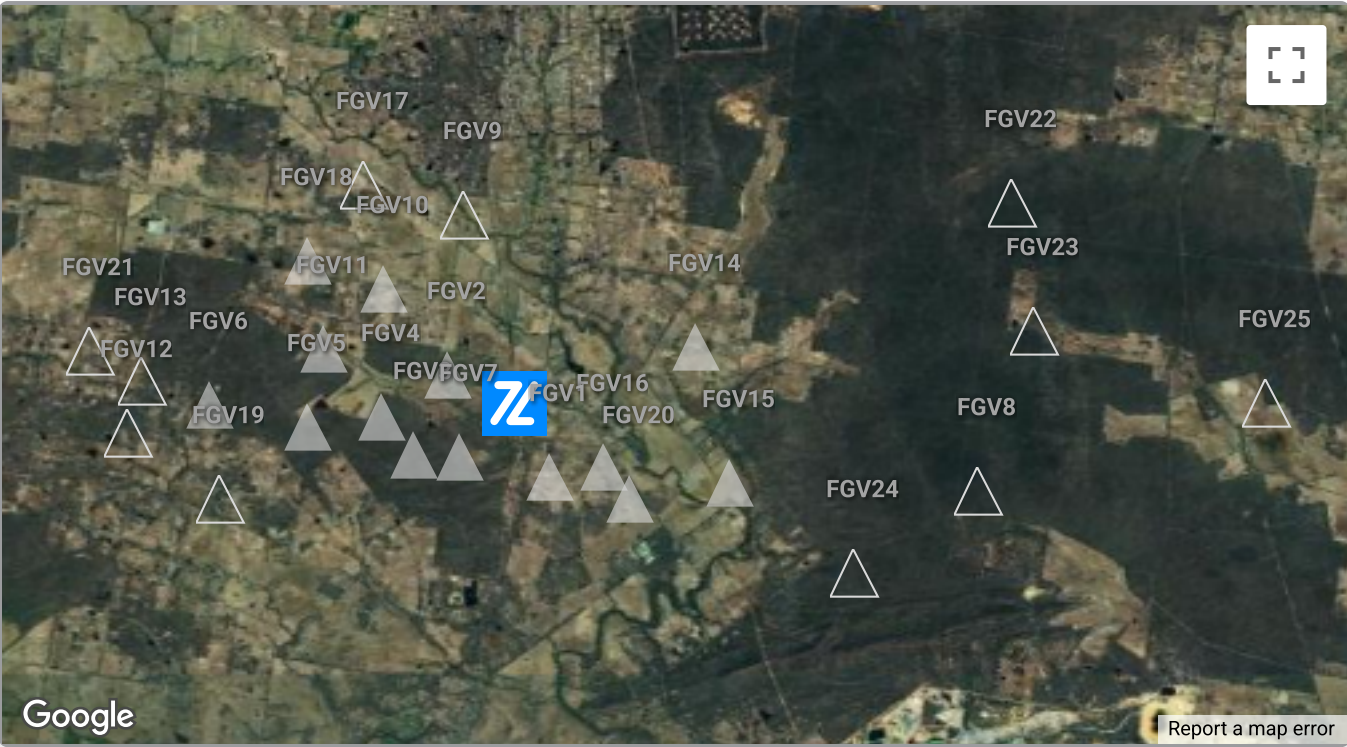

PPV Measurements

Site ID	X Component		Y Component		Z Component		Vector
	PPV (mm/s)	Freq (Hz)	PPV (mm/s)	Freq (Hz)	PPV (mm/s)	Freq (Hz)	
FGV2	0.48	76	0.29	61.9	0.29	91.7	0.50
FGV4	< 0.20	85	< 0.20	99.4	< 0.20	86.5	0.25
FGV11	0.22	39.8	0.20	39.6	< 0.20	35.7	0.24
FGV5	< 0.20	59.5	< 0.20	54.1	< 0.20	25.2	< 0.20
FGV3	< 0.20	57.3	< 0.20	17.5	< 0.20	36.0	< 0.20
FGV7	< 0.20	32.4	< 0.20	38.3	< 0.20	39.7	< 0.20
FGV16	< 0.20	32.7	< 0.20	23.9	< 0.20	42.1	< 0.20
FGV14	< 0.20	35.9	< 0.20	36.7	< 0.20	43.4	< 0.20
FGV10	< 0.20	41.1	< 0.20	19.7	< 0.20	50.6	< 0.20
FGV1	< 0.20	21.2	< 0.20	30.4	< 0.20	35.5	< 0.20
FGV6	< 0.20	66	< 0.20	57.1	< 0.20	20.7	< 0.20
FGV20	< 0.20	25	< 0.20	24.5	< 0.20	46.6	< 0.20
FGV15	< 0.20	19.5	< 0.20	20.6	< 0.20	27.7	< 0.20
FGV18	< 0.20	15	< 0.20	15.4	< 0.20	17.9	< 0.20
FGV8	-	-	-	-	-	-	-
FGV9	-	-	-	-	-	-	-
FGV12	-	-	-	-	-	-	-
FGV13	-	-	-	-	-	-	-
FGV17	-	-	-	-	-	-	-
FGV19	-	-	-	-	-	-	-
FGV21	-	-	-	-	-	-	-
FGV22	-	-	-	-	-	-	-
FGV23	-	-	-	-	-	-	-
FGV24	-	-	-	-	-	-	-
FGV25	-	-	-	-	-	-	-

Per-component Peak Particle Velocities (PPV) vs. Zero Crossing Frequencies.
Line indicates cosmetic damage guidelines
(residential buildings, Fig. J4.4.2.1, AS 2187.2:2006).

